

## VIDEO TECHNICAL BULLETIN

---

**MODELS**     VCM301HM

**SYMPTOM**    No motor actions.

**CAUSE**        R711 open circuit and IC702 short circuit.

**ACTION**        Replace R711 and IC702 using the part numbers given below.

<b><u>REF NO</u></b>	<b><u>PART NUMBER</u></b>	<b><u>DESCRIPTION</u></b>	<b><u>PRICE CODE</u></b>
IC702	VHiBA6978S/-1	Motor Drive IC	AL
R711	VRG-SC2EB1R0J	Resistor, 1R 0.25W	AB