



Month of Issue: June 1998

Classification: White

## TELEVISION TECHNICAL BULLETIN

Page 1 of 1

**DV5161H** MODELS

SYMPTOM Slow switch on, when the line comes up there is a loud screeching and hissing

from the line output transformer and R604 starts to smoke.

**CAUSE** R649 changed in value.

**ACTION** Replace R649 using the part number given below.

R649 is located across the emitter and collector of Q1010.

**REF NO DESCRIPTION PART NUMBER PRICE CODE** 

R649 15R, 1W VRS-VV3AB150J AB

