

**TELEVISION TECHNICAL BULLETIN**

**MODELS**      DV5932H                      DV5935H                      DV5937H                      DV6635H  
  
                    66AS06H

**SYMPTOM**    Lack of width (no east/west correction) with severe cramping of the lower half of the vertical scan

**CAUSE**        C607 and L604.

**ACTION**        Replace C607 and L604.

<b><u>REF NO</u></b>	<b><u>DESCRIPTION</u></b>	<b><u>PART NUMBER</u></b>	<b><u>PRICE CODE</u></b>
C607	Capacitor, 0.56uF 250V	RC-FZ6564BMNJ	AE
L604	Coil	RCILP0104CEZZ	AG