

## TELEVISION TECHNICAL BULLETIN

**Subject : Counter measure for intermittent flickering picture**

---

**SYMPTOM** During high brightness and subtitles the picture flickers.

**CAUSE** Poor repones of the video limiter.

**ACTION** Increase the value of C2442 located on the video/chroma PWB, from 47nF to 1 $\mu$ F 50V, using the part number shown below.

<b><u>REF NO</u></b>	<b><u>DESCRIPTION</u></b>	<b><u>PART NUMBER</u></b>	<b><u>PRICE CODE</u></b>
C2442	1 $\mu$ F 50V	VCEAGA1HW105M	AA