

**MODELS**      DV5932H                      DV5935H                      DV5937H                      DV6635H

**SYMPTOM**    Set permanetly in standby.

**CAUSE**        Cracked print around flyback transformer T600.

**ACTION**        Carry out the folloing action.

1. Repair print ensuring that all components are supported and tracking/arcng can not occur.
2. Fix a screw to the corner of the PWB next to T600, using the part number gievn below. This screw should always be fitted.

<b><u>REF NO</u></b>	<b><u>DESCRIPTION</u></b>	<b><u>PART NUMBER</u></b>	<b><u>PRICE CODE</u></b>
-	Screw	XTASD30P10000	AA