

**MODELS**      DV5932H                      DV5935H                      DV5937H                      DV6635H

**SYMPTOM**    Failure of C619.

**CAUSE**        R632 mounted too close to C619.

**ACTION**        Replace C619 as necessary and move R632 as shown in the diagram below.

Please carry out this circuit improvement to all sets that require service.

| <u>REF NO</u> | <u>DESCRIPTION</u>     | <u>PART NUMBER</u> | <u>PRICE CODE</u> |
|---------------|------------------------|--------------------|-------------------|
| C619          | Capacitor, 0.56nF 250V | RC-FZ6564BMNJ      | AB                |

Bend and separate resistor R632 away from C619 so that it is equally distant from C604 and C619

