

VIDEO TECHNICAL BULLETIN

<u>MODELS</u>	VCM26HM	VCM27HM	VCM271HM	VCM29HM
	VCMH67HM	VCMH675HM	VCMH68HM	VCMH69HM

SYMPTOM Dead or tripping power supply.

CAUSE -25V supply is low or missing, or no power supply feedback.

ACTION If the -25V supply is low or missing, replace D927 and R995.

If the D927 and R995 are not found to be faulty, then it is likely that the opto coupler, IC901, is faulty.

Please use the part numbers below for replacement parts.

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
D927	Diode, 1SS147	VHD1SS147//-1	AA
R995	SMD resistor, 10 (1/16W)	VRS-CY1JF100J	AA
IC901	Photo coupler	RH-FX0007GEZZ	AE