

VIDEO TECHNICAL BULLETIN

<u>MODELS</u>	VCM301HM	VCM311HM	VCMH711HM	VCMH721HM
	VCMH73HM	VCMH731HM		

SYMPTOM Intermittent reel functions as below.

1. Intermittent fast forward (may occur in standby)
2. Intermittent rewind (may occur in standby)
3. Intermittent play to fast forward or rewind

CAUSE Start and/or end sensor.

ACTION Change the start and end sensors.

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
Q701	Start sensor	RH-PX0233GEZZ	AD
Q702	End sensor	RH-PX0233GEZZ	AD