

VIDEO TECHNICAL BULLETIN

<u>MODELS</u>	VCMH721HM	VCMH73HM	VCMH730HM	VCMH711HM
	VCM311HM	VCMH311AHM	VCM331HM	VCM321HM
	VCM301HM			

SYMPTOM The PDC function does not work if the start time minutes are other than 00, 05, 10, 15, 20, 25, 30, 35, 40, 45, 50 or 55.

CAUSE Software bug.

ACTION Replace IC701 and IC705 from the listing below.

Note IC701 for models as follows.

RH-IX1417GEN2 VCM331HM, VCMH731HM

RH-IX1419GEN4 VCMH721HM, VCM321HM, VCMH73HM,
VCMH730HM, VCM311AHM

RH-IX1420GEN4 VCM311HM, VCM711HM, VCM301HM

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
IC701	Microprocessor	RH-IX1417GEN2	BB
IC701	Microprocessor	RH-IX1419GEN4	AZ
IC701	Microprocessor	RH-IX1420GEN4	AY
IC705	EEPROM	VHISLA2408S-1	AF