

TELEVISION TECHNICAL BULLETIN**MODELS** **VT3700H** **VT3705H****SYMPTOM** Unit does not turn on.**CAUSE** Excessive current drawn by the mechanism causing L752 to go open circuit.**ACTION** 1. Check D757 and replace if faulty.
 2. Check R761 and replace if faulty.
 3. Replace L752 with ferrite bead, part number given below.
 4. Replace D753 with new type, part number given below.

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
D757	Diode	RH-EX0217CEZZ	AB
R761	1R, Safety	VRG-RL2HB1ROK	AB
L752	Ferrite Bead	RBLN-0037CEZZ	AB
D753	Diode	RH-DX0247CEZZ	AE