

SONY

car stereo Service Bulletin No.81

Technical Department
Sony Service Company
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-A10

Date: September 4, 1987

Subject: Disc Magazine Jams In The Unit
During Eject

Symptom:

(65)


When using the XA-10B disc magazine in the unit, the magazine may get stuck during eject.

Solution:

Lubricate the guide slots on the XA-10B magazine using the following procedure:

1. Lubricate the four guide slots (A-D) shown in the diagram with a small amount of silicon oil (P/N 7-661-012-15) using an applicator (cotton swab, etc).
2. Leave as is for one minute.
3. Wipe the applied oil with a cloth.

Note: The XA-10 (grey type) already has a dry lubricant applied.

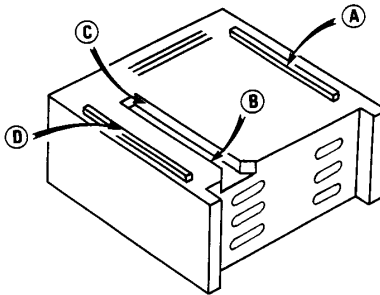

Bottom view of XA-10B