

SONY

car stereo Service Bulletin No.85

Technical Department
Sony Service Company
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656


Model: CDX-5/R7

Date: September 18, 1987

Subject: No Eject

Symptom:
(65)

The compact disc is not ejected when the set is installed at a 20° angle. At this angle, the lid remains open so when the roller moves up the disc to eject it, the disc pivots, hits part A of the lid, getting stuck.

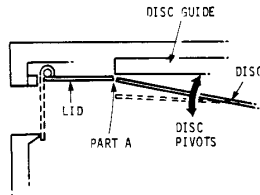

Solution:

Insert two spacers (3-323-288-01) between the DET (B) PC board and the MD frame assembly.

