

SONY

car stereo Service Bulletin No.89

Technical Department
Sony Service Company
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-550R

Date: October 16, 1987

Subject: Unit Continuously Cycles
Direction

Symptom:
(62)


When a tape is inserted, the unit will continuously cycle directions. The head plate moves in and out but never locks.

Cause:

C708 on the Main PCB obstructs the movement of the STOP ARM (Ref. No. 224). This bends the STOP ARM.

Solution:

Bend the STOP ARM to restore original shape or replace STOP ARM. Reposition C708 so it does not obstruct the STOP ARM.

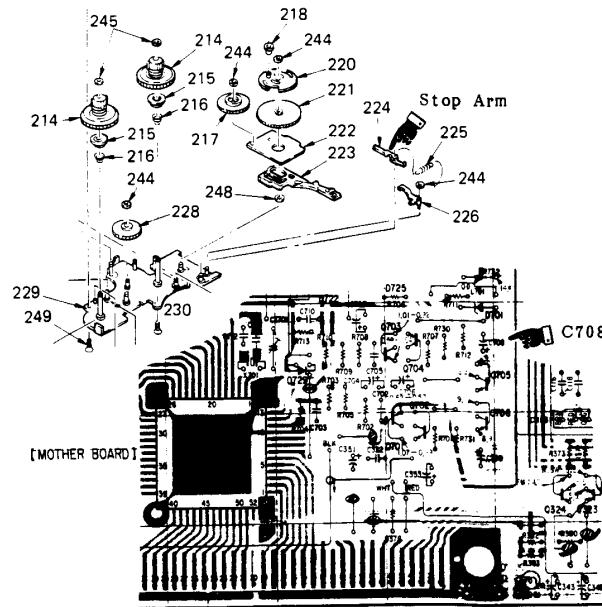

2CS1087-4

Printed in USA