

SONY

Car Stereo
Service Bulletin

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-R88

No. 99

Subject: Skipping

Date: May 9, 1988

Symptom:
(62)

Intermittent skipping caused by an incorrect tracking offset waveform and low RF gain.

Solution:

Adjust the traverse waveform of the tracking error signal so a symmetrical waveform is obtained on the scope in relation to OV. Then change R505 and R571 from 62ohm to 47ohm (part number 1-249-401-11).

Ref No.	Description	Former	New
R505, R571	1/6W Resistor	1-215-392-00	1-249-401-11

Compact Disc
CSA-14

Reference:

PRINTED IN U.S.A.
2CSA-14488-4