

SONY

**Car Stereo
Service Bulletin**

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-7100

No. 100


Subject: Interruption Of Audio When
Illumination Is Switched On/Off

Date: May 9, 1988

Symptom:
(51)

The audio output may be interrupted for an instant when the illumination is turned on or off. This is due to a muting circuit momentarily engaging.

Solution: Remove diode D230. This has already been changed in production. The diode needs to be removed for serial numbers 10001 - 18100.

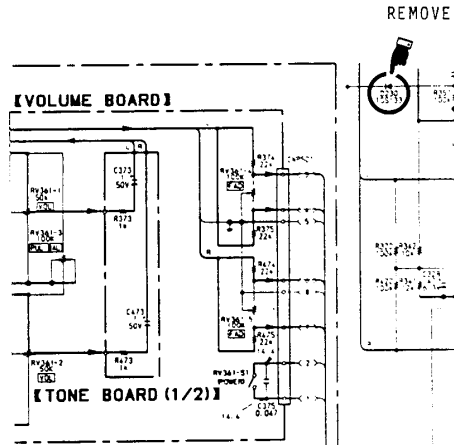

Affected Serial Numbers

10001 → 18100

Reference: Tech News AU88010

PRINTED IN U.S.A.
CSA-14488-5

CSA-14 Tuner/Tape Deck