

**SONY**

Car Stereo  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** XR-7100

**No.** 113

**Subject:** Clock Display Jumps Or Resets  
When Starting The Car

**Date:** November 18, 1988

**Solution:** This is caused by a software bug in the system control. If customer complains of this problem, replace IC201 with a new version.

Designation	Description	Part Number	
		Former	New
IC201	System Control	8-759-111-92	8-759-142-17

Tuner/Tape Deck

CSA-14

Reference: Europe CS-02288

PRINTED IN U.S.A.  
CSA-141188-2