

SONY

**Car Stereo
Service Bulletin**

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-A20/A20R

No. 114

Subject: Skipping On Scratched Discs

Date: November 18, 1988


Symptom:
(62)

Skipping occurs during idling, or when driving on normal roads.

Note: This does not apply to skipping caused by car vibration.

Solution: Please replace the following parts:

Ref. No.	Description		New Part Number
	Former	New	
R14	82k Ω	330k Ω	1-215-481-00
R15	15k Ω	68k Ω	1-249-439-11
R52	8.2k Ω	15k Ω	1-249-431-11
C8	0.0047 μ F	0.018 μ F	1-163-062-00
C24	3.3 μ F	0.056 μ F	1-136-162-00
C25	22 μ F	2.2 μ F	1-124-257-00
C54	20pF	Remove	

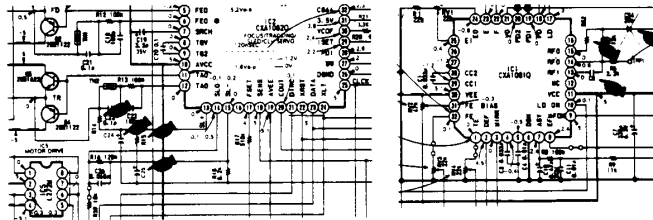

Reference: T/N DS-088-0054

PRINTED IN U.S.A.
CSA-141188-3

Compact Disc

CSA-14