

**SONY**

Car Stereo  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** XE-90

**No.** 116

**Subject:** LEDs Do Not Light

**Date:** November 22, 1988

**Symptom:**  
(13)

The LEDs which are mounted on the frequency bands or fader knobs may not light.

**Solution:** This is caused by high contact resistance of the potentiometer. Replace the key board unit with an improved version listed below. The new and old part numbers are the same but we now stock the improved version.

Designation	Description	Part Number	
		Former	New
902	Key Board Unit	1-464-966-11	1-464-966-11

**Note:** Applicable to U.S. Serial Numbers: 10,001 - 16,000.

Reference: T/N AU88037

PRINTED IN U.S.A.  
CSA-141188-5

Miscellaneous

CSA-14