

SONY.

**Car Stereo
Service Bulletin**

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-7200

No. 119

Subject: No LCD Display

Date: January 2, 1989


Symptom:
(13)

No display or incorrect display on the LCD.

Ringling generated on the LCD power line when turning on the power may ruin the LCD.

Solution: Add a diode as a shunt across L2 as shown:

Description	Part Number
Diode 1SS119	8-719-911-19

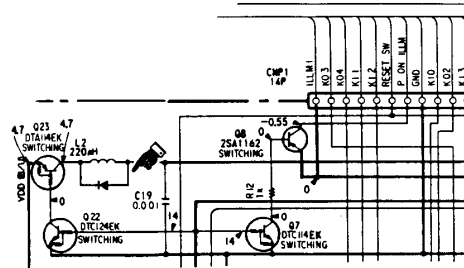

Tuner / Tape Deck

CSA-14

Reference: T/N AV88042

PRINTED IN U.S.A.
CSA-141288-2