

SONY

Car Stereo
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-7150

No. 123

Subject: No Playback; E-99 is Displayed

Date: March 8, 1989

Symptom:
(65)

When E-99 appears on the display, only the eject command is accepted. If disc is ejected and re-inserted, the problem is cleared. If eject is not pressed, the unit switches from tape to tuner mode.

Solution:

The cause is a mode lever that cannot move due to misengagement of the FR and FLY gear cogs.

Replace the micro IC301 with the new one listed. The new microprocessor has a new program routine which rotates the capstan for 0.5 seconds before the recovery operation and prevents the misengagement.

Ref. No.	Description	Former		New	
		Type	Part Number	Type	Part Number
IC301	Microprocessor	MPD751086-642-1B	8-759-142-08	MPD751086-666-1B	8-759-142-20

Applicable U.S. Serial Numbers: 10,001 - 16,000
20,601 - 22,600
25,001 - 29,000
30,001 - 32,000

Reference: T/N AV88040

PRINTED IN U.S.A.
CSA-14289-1

CSA-14 Tuner/Tape Deck