

**SONY**

Car Stereo  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** XE-8

**No.** 128

**Subject:** System With XE-8 Does Not Operate **Date:** May 8, 1989

**Symptom:**  
(11)

The entire system in the car does not operate. The symptoms on the XE-8 itself are:

1. Remains illuminated continuously.
2. Spectrum Analyzer display is fully lit. This is caused by the battery mirror circuit not turning on.

**Solution:** Change the following parts:

Description	Part Number
Improved Parts Assembly	X-3339-911-1

Ref. No.	Description	
	Former	New
R504	5.6k Ohm	47k Ohm
R515	5.6k Ohm	
R673	2.4k Ohm	3k Ohm
R705	10k Ohm	150k Ohm
R907	4.7 Ohm	Remove and Short-Circuit With Wire
C903	33uF/25V	Remove
D672 D673	----	Add 1SS199
----	----	Cut a Pattern

(Continued)

Reference: TN: AU88038


PRINTED IN U.S.A.  
CSA-14489-4

Miscellaneous

CSA-14

Car Stereo Service Bulletin No. 128

(ANALOG BOARD)

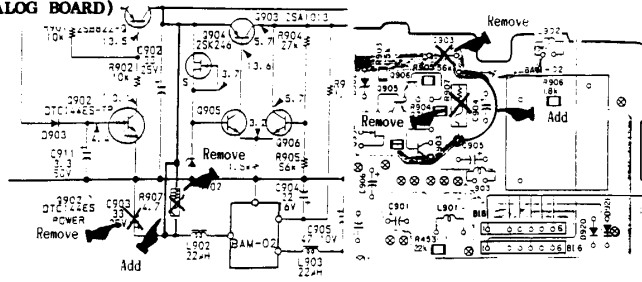

(DIGITAL BOARD)

