

**SONY**

Car Stereo  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** RM-X1/X2, CDX-A10/A20,  
XR-750/7200/7300/7400

**No. 129**

**Subject:** Error Code Meaning

**Date:** May 8, 1989

**Symptom:**  
(\*\*)

The following table lists the meanings of the error codes which may appear on control units connected to a CDX-A10 or CDX-A20:

**Solution:**

Error Codes				Meaning
RM-X1	RM-X2	XR-750/ 7200/7400	XR-7300	
E01	E01	E01	DISC	Magazine Has Not Been Inserted or 16 Seconds Have Elapsed During Loading
E02	E02	E02	DISC	There are No Discs in Magazine or 15 Seconds Have Elapsed and Limit Switch Has Not Been Turned On
E03	E03	---	---	Selected Disc and Track Do Not Exist or Access Time Has Exceeded 20 Sec.
E04	E04	E04	DISC	TOC is Not Read, No Focus Cause: Disc is Defective, Disc was Inserted Upside Down
---	E05	---	---	Disc and Track Input or Programming Was Not Accepted or 6FS Error
---	E07	---	---	Eject Time Has Exceeded 16 Seconds
WAIT	WAIT	WAIT	---	Mechanical Section in Motion
WAIT	WAIT	WAIT	TEMP	High Temperature
E99	E99	E99	E99	No Motion

CD Changer  
CSA-14

Reference: TOKYO

PRINTED IN U.S.A.  
CSA-14489-5