

SONY

Car Stereo
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-A30

No. 130

Subject: Distorted Audio When Connected
To RM-X2


Date: May 8, 1989

Symptom:
(53)

There is distorted audio when the CDX-A30 is connected to an RM-X2. This is caused by both units floating the ground connection at their end.

Solution:

Jumper across Pins 3 and 7 on the input connector as shown:

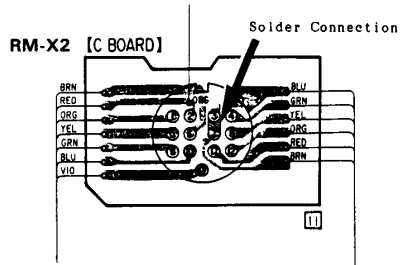

CD Changer

CSA-14

Reference: Tokyo

PRINTED IN U.S.A.
CSA-14489-6