

SONY

**Car Stereo
Service Bulletin**

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-7050

No. 131R2

Subject: Intermittent FM Reception

Date: June 20, 1991


This bulletin supersedes Car Stereo Service Bulletin No. 131R1

Symptom:
(21)

When receiving FM, the high-frequency range of the audio signal is cut off intermittently, especially when driving in a weak electric field. This is caused by misoperation of the high cut circuit.

Solution: Change the following parts on the main board:

Description				
Ref. No.	Former	New	Part Number	Remarks
R152	68k Ohm	33k Ohm	1-247-726-11	
R251	6.8k Ohm	1SS133	8-719-901-33	
C254	0.0082µF	0.01µF	1-161-051-00	
C270/280	0.022µF	0.027µF	1-161-056-00	
---	---	2.2k Ohm	1-247-717-11	Mount resistor in series with D250
R157	47k Ohm	68k Ohm	1-249-467-11	

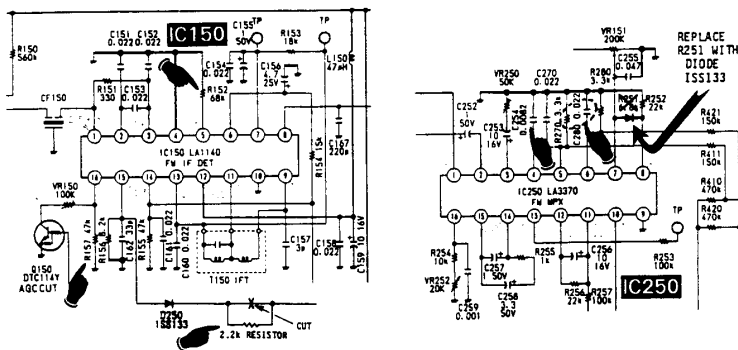

Reference: TN: AU89004

PRINTED IN U.S.A.
CSA-14691-1

CSA-14 Tuner / Tape Deck