

SONY

Car Stereo
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-R88

No. 132

Subject: Eject or No Playback After Loading **Date:** May 8, 1989

Symptom:
(65)

- A. Eject or no playback after loading.
- B. Mechanical noise.


- A. Due to severe damage caused by transportation, the chucking plate may suddenly move so that its retainer spring shifts underneath the plate.
- B. A longer screw may have been used to install the unit in the car instead of the one supplied so that the DC/DC converter or the metal lever may be damaged.

Solution: A. Bend the retaining spring of the chucking plate as shown:

Bend the chucking
plate retainer
spring over the
horizontal plane

Chucking plate
retainer spring
Bend

B. Use the supplied screw.

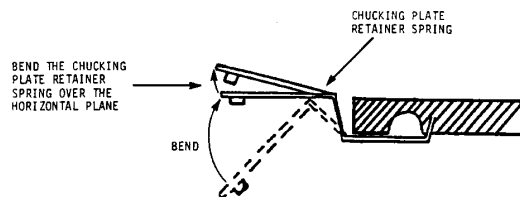

Reference: TN: DS088-0107

PRINTED IN U.S.A.
CSA-14489-8

Compact Disc

CSA-14