

SONY

Car Stereo Service Bulletin

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: RM-X2/XK-8D

No. 134

Subject: XK-8D Cannot Be Operated With
RM-X2

Date: May 24, 1989


Symptom:
(11)

When an RM-X2 is connected with an XK-8D, it does not operate. The current which is supplied by the RM-X2 is insufficient for driving the XK-8D.

Solution: Please replace R380, Q311 as follows:

Ref. No.	Description		Part Number
	Former	New	
R380	1k Ohm	1 Ohm	1-249-447-11
Q311	2SB731	2SB1202	8-729-805-20

Applicable Serial No.: 52,201 - 53,700 and 54,501 - 55,500

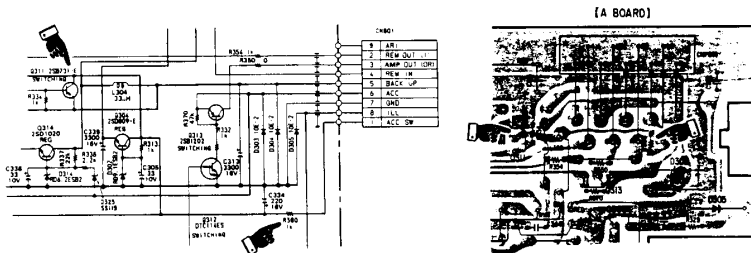

Reference: T/N AU89012

PRINTED IN U.S.A.
CSA-14589-1

CSA-14 Tape Deck / Miscellaneous