

SONY

**Car Stereo
Service Bulletin**

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-A20

No. 135


Subject: Improvement Of Signal To
Noise Ratio

Date: May 24, 1989


Symptom:
(54)

When between tracks (no sound) or quiet passages, servo noise may be heard.

Solution: Perform the following:

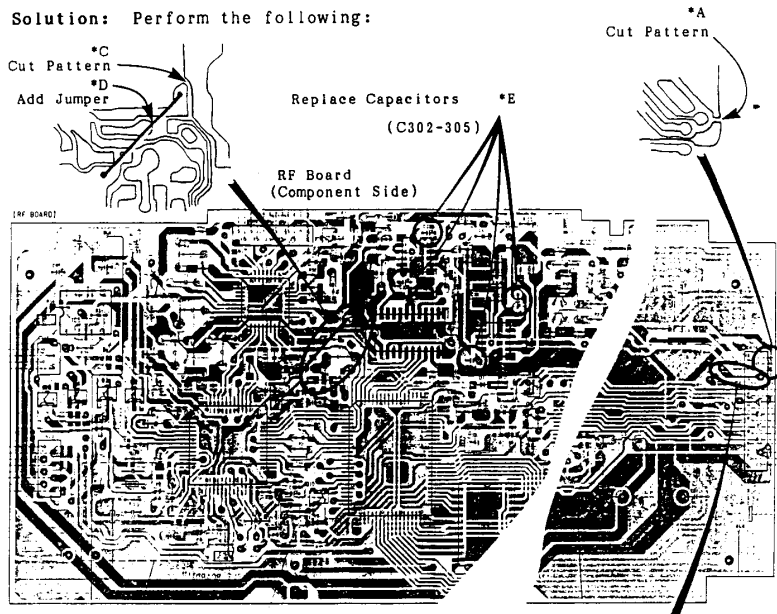

Ref. No.	Description		Part Number
	Former	New	
C302-305	100/6.3V	1/50V	1-121-912-00

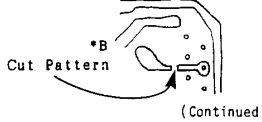

(Continued)

Reference: Tokyo

PRINTED IN U.S.A.
CSA-14589-2

CSA-14 Compact Disc

