

**SONY.**

**Car Stereo  
Service Bulletin**

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-R77, CDX-R79

**No. 137R1**

**Subject:** Intermittent, No Play

**Date:** August 7, 1989

This service bulletin supercedes Car Stereo Service Bulletin No. 137.

**Symptom:**  
(12)


If the ignition is turned Off (ACC lead HIGH to LOW), while playing a CD, and then ignition is turned On, no functions will be accepted and there will be no display indication.

**Solution:** Please replace capacitor C410 with a new value as shown below:

Ref. No.	Former Part	New Part	
		Description	Part Number
C410	10 $\mu$ F/10V	22 $\mu$ F/16V	1-124-234-00

**Applicable U.S. Serial Numbers:**

CDX-R77	10,000 - 13,000
	15,001 - 23,000
	24,501 - 29,500
CDX-R79	10,001 - 13,000
	16,501 - 20,000

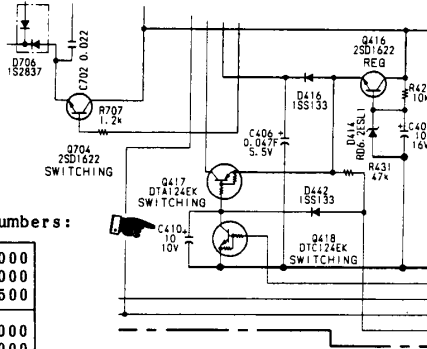

Reference: T/N AU89031

PRINTED IN U.S.A.  
CSA-14789-2

CSA-14 Compact Disc