

SONY

Car Stereo
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-7150/7200

No. 140

Subject: Erratic Ejection


Date: May 24, 1989

Symptom:
(62)

Cassette is ejected just after loading or while changing direction. This is caused by poor S10 switch contact caused by dust or deformation of the contacts.

Solution: Replace the "SWITCH" and "HOLDER" with new ones, as an assembly. The color of the old holder is white, while the color of the new holder in the assembly is black.

Ref. No.	Description	Part Number
152	Contact Holder	A-3239-952-A
153	Switch Contact	

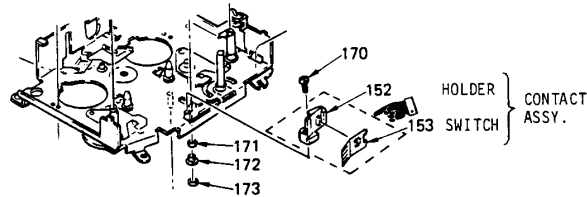

CSA-14 Tuner / Tape Deck