

SONY

**Car Stereo
Service Bulletin**

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-A30

No. 143

Subject: High Pitch Noise During Playback

Date: August 7, 1989

Symptom:
(54)

At high volume levels, a high pitch noise can be heard between tracks and during quiet passages. This noise may be difficult to hear at low or normal volume settings.


Cause:
The characteristics of the low-pass filter has changed.

Solution: Replace the chemical capacitors C49, C302, C303, C304, and C305 with the parts listed below:

| Ref. No. | Former Part | New Part | |
|---------------------------|-------------------|------------------|--------------|
| | | Description | Part Number |
| C49 | 3300 μ F/6.3V | 330 μ F/6.3V | 1-124-442-00 |
| C302, C303, C304, C305 | 100 μ F/6.3V | 2.2 μ F/50V | 1-124-257-00 |

Applicable U.S. Serial Numbers:

16,301 - 21,300

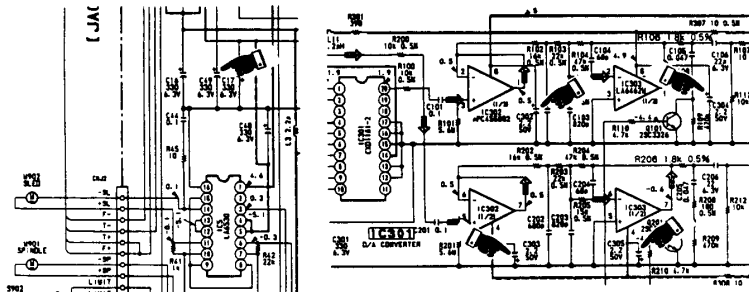

Reference: T/N AU89028

PRINTED IN U.S.A.
CSA-14789-3

CSA-14 Compact Disc