

SONY

Car Stereo
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-R77, CDX-R79

No. 145

Subject: Volume Control Does Not Work

Date: September 15, 1989

Symptom:
(22)

If the customer complains the volume control does not operate on hot days, please change the parts listed below:

Cause:


At power up, the rise time for the analog and digital power supplies do not match causing the electrical volume to lock up.

Solution: Replace the following chemical capacitors:

Ref. No.	Former Part	New Part	
		Description	Part Number
C403	100 μ F/10V	47 μ F/16V	1-124-589-11
C404	10 μ F/16V	22 μ F/16V	1-124-234-00

Applicable U.S. Serial Numbers:

CDX-R77	10,000 - 13,000
	15,001 - 23,000
	24,501 - 29,500
CDX-R79	10,001 - 13,000
	16,501 - 20,000
CDX-R79L	-----

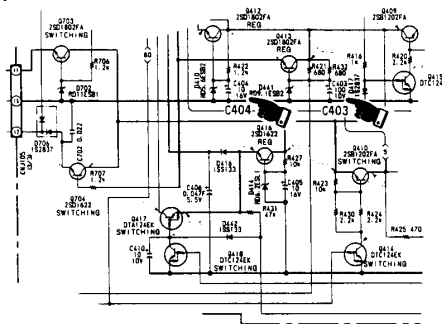

Reference: T/N AU89031

PRINTED IN U.S.A.
CSA-14889-2

Compact Disc
CSA-14