

SONY.

Car Stereo Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-R77, CDX-R79

No. 147

Subject: Malfunction When Starting Car Engine

Date: September 29, 1989

Symptom:
(12)

1. If a disc is left in the unit, the disc will rotate, but no sound will be heard.
2. Radio will come on with no station tuned, usually at bottom of FM dial (87.9MHz)
3. No display indication.

Cause: The time for which voltage is applied to the ACC line as the ignition switch is turned from Off to On (L - H) is too short for microprocessor.


Solution: To change the timing of the circuit, change the value of C410 as follows:

Description			
Ref. No.	Former	New	Part Number
C410	10 μ F/10V	22 μ F/16V	1-124-234-00

Applicable U.S. Serial Numbers:

CDX-R77: 10,001 - 13,000
15,001 - 23,000
24,501 - 29,500

CDX-R79: 10,001 - 13,000
16,501 - 20,000

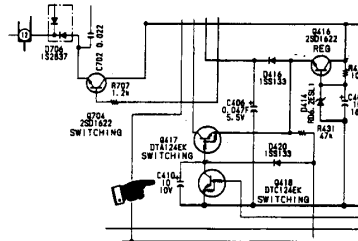

Reference: T/N AU89032

PRINTED IN U.S.A.
CSA-14989-1

Compact Disc
CSA-14