

**SONY**

Car Stereo  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-R79

**No.** 150

**Subject:** Change Of Illumination Color

**Date:** December 29, 1989

**Symptom:**  
(13)

If the unit is removed from the bracket for several hours after the illumination color was set to green, the illumination color may change back to amber when the unit is re-installed.

**Solution:** If the customer complains of this, please change the microprocessor as shown below:

Ref. No.	Description		
	Former	New	Part Number
IC501	CXP5048H-196Q	CXP5048H- <u>207Q</u>	8-752-814-12

[Applicable Serial Numbers]

Serial Numbers: 10,001 - 16,700

The units with a green circle next to the serial number have been improved, though their serial numbers are within applicable range.

Compact Disc  
CSA-14