

**SONY**

Car Stereo  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-R77/R79

**No.** 151

**Subject:** Scratches A Disc

**Date:** December 29, 1989

**Symptom:**  
(65)

The label side of a disc is scratched (see the figure below).  
A disc without a hard coating is easily scratched.




**Cause:** When inserting a disc, the Disc Guide is scratched by the burr of the disc itself, which causes scratches on the next disc.

**Solution:** Replace the former Disc Guide with an improved one.

Ref. No.	Description	Part Number	
		Former	New
358	Guide, Disc	3-351-460-01	3-351-460-0 <u>5</u>

[How to Distinguish Improved Guide from the Former One]

	Former	Improved
A	18 mm	20 mm

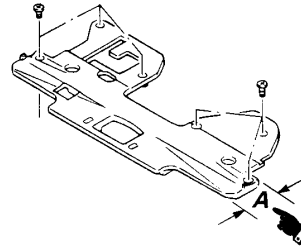

[Applicable Serial Numbers]

MD Serial Numbers: Up to 95,120

Reference: T/N ME-89002

PRINTED IN U.S.A.  
CSA-141189-2

Compact Disc  
CSA-14