

SONY

Car Stereo
Service Bulletin

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-300

No. 161

Subject: Excessive Wow and Flutter /Speed
is Slow

Date: February 16, 1990

Symptom:
(57)

The unit has excessive wow and flutter on playback. The speed is also too slow. The FF/REW function may not work either.

Solution: Please change the following parts:

Ref. No.	Description	Part Number	
		Former	New
M901	Motor Assembly	3-392-908-01	3-392-908-02
232	FRY (F) Wheel	3-392-926-01	3-392-926-02
224	FRY (R) Wheel	3-392-995-01	3-392-995-02
HP901	PB Head	1-542-529-11	X-3348-013-1

Ref. No.	Description		Part Number
	Former	New	
C402 C422	0.0015mfd Capacitor	0.001mfd Capacitor	1-163-205-11
R403 R423	10k Ohm Resistor	9.1k Ohm Resistor	1-247-854-11

Reference:

PRINTED IN U.S.A.
CSA-14290-1

CSA-14 Tuner / Tape Deck