

SONY

**Car Stereo
Service Bulletin**

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-66/740/A740/780/787R

No. 164

Subject: Intermittent No Eject



Date: February 16, 1990

Symptom:
(62)

Irregular eject in play mode. IC701 has been changed from TC9310N-065 to TC9312-040. A further modification is necessary as instructed below when using TC9312-040.

- Solution:**
1. Change the value of R719 from 27k Ohm to 47k Ohm.
 2. Remove the timing board for the units in which the timing board is installed. The timing board is attached to the outside of the motor.

Ref. No.	Description		Part Number
	Former	New	
IC701	TC9310N-065	TC9312-040	8-759-207-77
R719	27k Ohm	47k Ohm	1-249-437-11

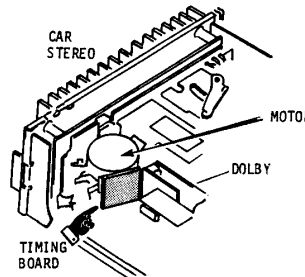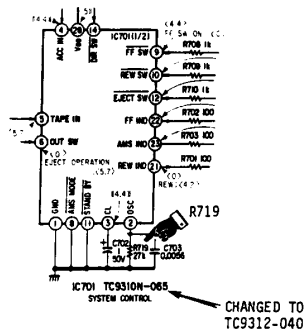

CSA-14 Tuner / Tape Deck

Reference: From Tokyo

PRINTED IN U.S.A.
CSA-14290-4