

**SONY**

Car Stereo  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-44/6020/7540/7580/R77/R79

**No.** 174

**Subject:** Some Functions Do Not Operate


**Date:** October 15, 1990

**Symptom:**  
(22)

The Display PCB becomes unseated from the plastic clips that hold the lower edge of the board causing no operation of several buttons on the front panel.

**Solution:** If this symptom occurs, insert a 3mm piece of rubber foam, Part Number 9-911-815-01, between the Front Panel and the top edge of the PCB, as shown below.

When installing the unit, press the PCB following the arrow and tighten screws.

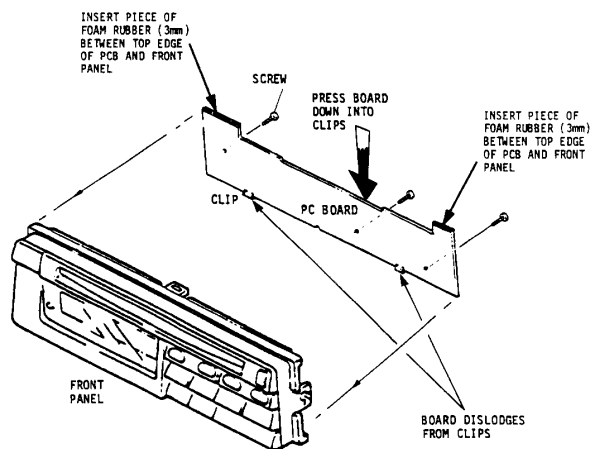

Reference: TX-90121

PRINTED IN U.S.A.  
CSA-14990-1

CSA-14990-1  
Copyright © 1990 Sony Electronics Inc.