

SONY.

**Car Stereo
Service Bulletin**

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-A100

No. 181

Subject: No Operation and No Eject
("E99" Is Indicated)

Date: November 7, 1990


Symptom:
(12)

The unit neither operates nor ejects ("E99" is indicated). This happens when the Relay Board touches the MD Chassis and the M1 Motor will not turn.

Solution: If this symptom occurs, please attach a cushion to the Relay Board for insulation.

1. Remove Rear Case.
2. Remove Case Assembly.
3. Remove Upper Case Assembly.
4. Pull out all the connectors of the Relay Board, and unscrew and take out the Relay Board (Fig. 1).

Caution: Be careful not to break the lead wire, especially when pulling out a connector with a green lead wire.

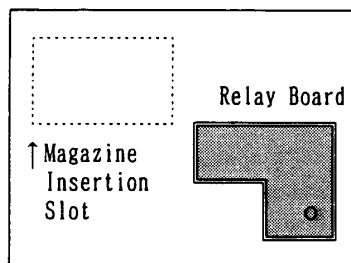


MD BOTTOM SIDE

Fig. 1.

(continued)

CSA-11

5. Attach a cushion to the spot marked  on the Relay Board (Fig. 2).

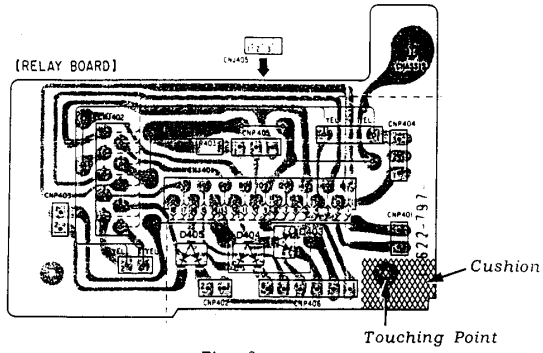


Fig. 2.

Description	Part Number
Cushion	3-831-441-11

Applicable Serial Numbers: 100,301 to 107,301