

**SONY.**

# Car Stereo Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-R77/R79

**No.184**

**Subject:** CD Only Plays When Unit Is Turned  
Upside Down

**Date:** November 19, 1990



**Symptom:**  
(12)

CD only plays when unit is turned upside down.

**Solution:** If this symptom occurs, replace Driver Transistors Q402 to Q417 and the FOP.

Ref. No.	Description	Part Number
Q402/404/406/408/ 410/412/414/416	Transistor 2SD1624	8-729-808-42
Q403/405/407/409/ 411/413/415/417	Transistor 2SB1124	8-729-820-60
	Optical Pickup KSS-168ARP	8-848-124-11

Compact Disc  
CSA-14

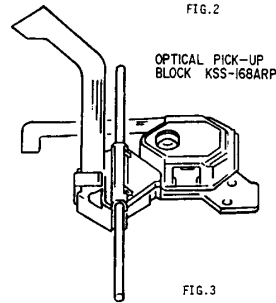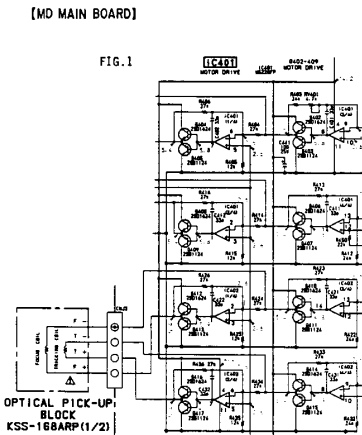

Reference: FPR #L1255

PRINTED IN U.S.A.  
CSA-141190-2