

SONY

Car Stereo
Service Bulletin

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-7560/7580

No. 186

Subject: Power Not On When Inserting Unit, No Sound (Power) While Driving
Date: November 30, 1990


Subject: Power Not On When Inserting Unit, No Sound (Power) While Driving

Symptom: The unit will not power On after being inserted, or there is no sound (power) while driving.
(11)

Cause: There is incomplete contact of the unit and the connector on the bracket assembly. This is due to the rear of the bracket pushing against the car body. Therefore, the unit is not inserted completely and SW901 (handle) is set in the Off mode.

Solution: If this symptom occurs, install a spacer (P/N X-3362-588-1) by performing the following procedure:

1. Remove the amplifier from the bracket.
2. Use a screwdriver to widen the gap at the rear of the bracket.
3. At the same time, peel off the film from the supplied spacer and insert and attach it to the bracket.
4. Attach the supplied tape as illustrated.
5. Remove the screw and replace it with the supplied screw as illustrated.
6. Attach the amplifier back to the bracket.

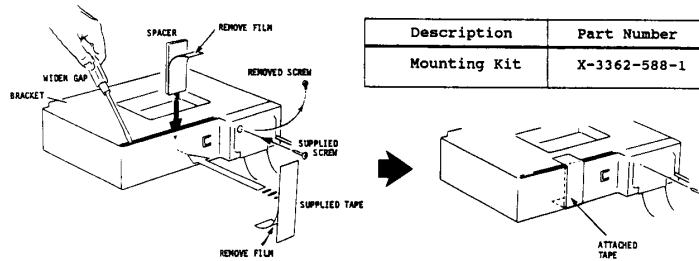

Description	Part Number
Mounting Kit	X-3362-588-1

Reference: ME-90008

PRINTED IN U.S.A.
CSA-141190-4

Compact Disc
CSA-14