

SONY

**Car Stereo
Service Bulletin**

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XE-90MKII

No. 189

Subject: IC101/PC Board Compatibility
Problem

Date: January 7, 1991

Symptom:
(53)


Audio distorted.

Solution: If this symptom occurs, please perform the following procedure:

Replace IC101 and/or IC102 with Part Number 8-759-710-73 (NJM4580L). This is an 8-pin in-line package which will fit the PC Board without modification.

If this part is not available, then order Part Number 8-759-112-93 (uPC4570HA). This is a 9-pin in-line package which may be used if Pin 1 is removed and the IC is inserted so that Pin 2 is located in the PC Board Pin 1 position.

Amplifier
CSA-14

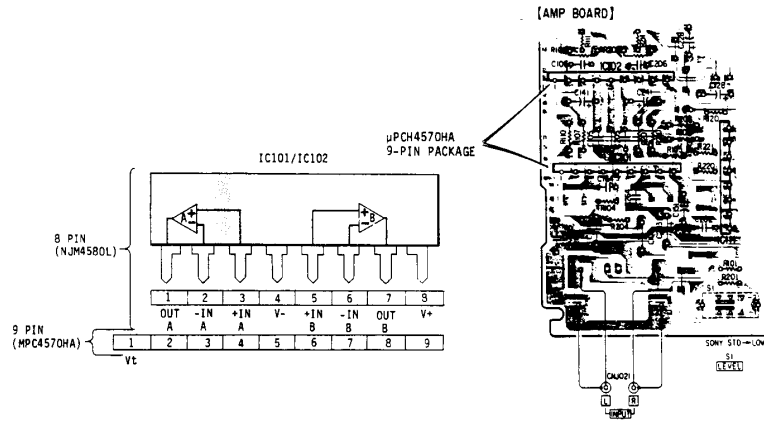

Reference: FPR L1824

PRINTED IN U.S.A.
CSA-141290-3