

SONY

Car Stereo
Service Bulletin

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-7180

No. 191

Subject: PH-11/12 Incompatibility

Date: January 30, 1991

Symptom:
(**)

The beveled corner on PH-11/12 Photo Sensors is at Pin 1 instead of Pin 2, as shown in the service manual. The Reel Board PCB layout is different than in the service manual as well.

Solution: The Reel Board has been revised to include a new PCB layout and different photo sensors for PH-11/12. When ordering PH-11/12, follow the chart below to match Reel Board of unit being repaired with the correct Photo Sensor(s).

Description	Part Number	
	Former	New
Reel Board	1-628-613-11	1-624-412-14
Photo Sensor PH-11/12	8-719-420-46 8-719-420-47	8-719-939-11

CSA-14 Tape Deck