

SONY

**Car Stereo
Service Bulletin**

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-7520/-7540/-7560/-7580

No. 197

Subject: Unit Mutes While Making Turns And
During Braking


Date: April 19, 1991

Symptom:
(57)

If the unit mutes while making turns or during braking, perform the following procedure:

- Solution:**
1. Install non-woven tape (9mm x 25mm) on the chassis (main) assembly (as shown in the drawing below).
 2. Fold flexible circuit board "B" at indentations towards the inside of the deck.

Description	Part Number
Non-Woven Fabric Tape (10cm x 20cm)	3-831-441-11

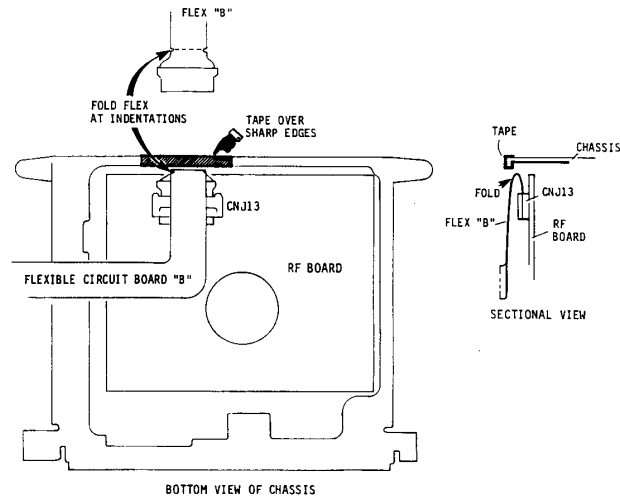

Reference: Tech. News #ME91004
Autoflagging: (YES)

PRINTED IN U.S.A.
CSA-14491-3

CSA-14 CD Player