

SONY

Car Stereo
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XM-3040/-3520

No. 200R1

Subject: Protection Turns On

Date: July 29, 1991

This bulletin supersedes Car Stereo Service Bulletin No. 200


Symptom:
(51)

The Protection Circuit is activated when the amplifier is connected to other equipment or when it is tested alone.

Serial Numbers applicable: XM-3040 Up to 28,100
XM-3520 Up to 30,750

Solution: Add the following resistor between the two grounds on the "Main" Board as shown below:

Description	Part Number
470 Ohms 1 W resistor	1-215-867-00

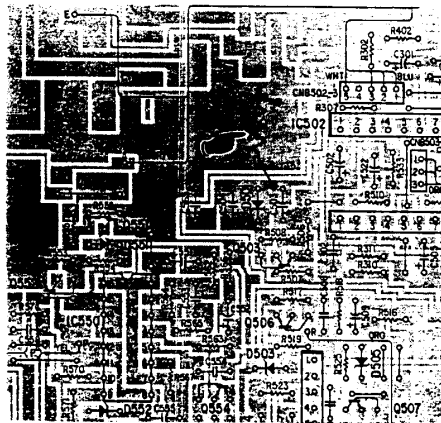


XM-3040

Reference: CS-00591
Autoflagging: (Yes)

PRINTED IN U.S.A.
CSA-14691-4

Amplifier
CSA-14

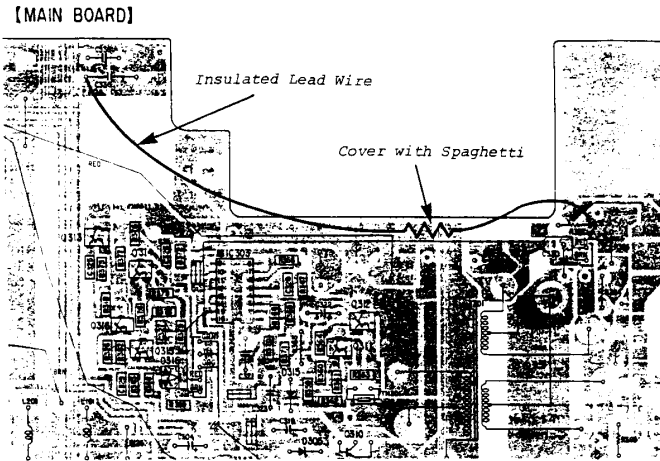

XM-3520