

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-3310/4410

No. 353

Subject: Clock Runs Slow.

Date: February 21, 1995

Symptom:
(13)

The displayed time may lose approximately 1.5 minutes every 10 days.

Solution:

If the customer complains of this problem, change C305 and C306 on the Main board as shown below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
C305 C306	CAPACITOR, CHIP, 22 pF	1-163-235-91	CAPACITOR, CHIP, 8 pF	1-163-225-91



