

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-U770/U880

No. 354

Subject: Audio Distortion, Noise, No Audio From One Channel, Tape Mechanism Malfunctions Or Does Not Operate At All.

Date: February 21, 1995

Symptom:
(53)

The above symptoms may appear if any of the electrolytic capacitors in the unit leak. The actual symptom observed depends upon which capacitor leaks.

Solution:

A parts kit containing all of the electrolytic capacitors found in these models is available from the National Parts Center. Although the unit may exhibit only one symptom, all of the applicable capacitors should be changed to prevent additional symptoms from appearing in the future.

The applicable capacitors are made by ELNA and are red. Furthermore, only those red capacitors which are printed with a number of "235" or lower, or in the case of a 4 digit number "9235" or lower, need to be changed.

REF	DESCRIPTION	PART NUMBER
-	CAPACITOR KIT	X-3370-221-1



