

# Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

---

**Model:** MDX-40/400

**No.** 359

**Subject:** Preventing Mechanism Damage During Shipping.

**Date:** May 1, 1995

**Symptom:**

(\*\*)

The mechanism flex cables and/or KA2 gear may be damaged during shipping if the mechanism is not properly locked.

**Solution:**

- 1- Install the customer's magazine into the mechanism.
- 2- Apply power to the system.
- 3- Press preset button "4", then press preset button "5", then press preset button "1" and keep it pressed until all the segments of the display are illuminated (On the MDX-400 the preset buttons and display are found on the in-dash portion of the system. On the MDX-40, the preset buttons and display are found on a Unilink equipped head unit to which the MDX-40 must be connected).
- 4- The mechanism will rotate to the disc number 3 position, at which point it will move to the disc-chucked position.
- 5- Remove the Unilink cable from the mechanism (be careful not to press any buttons, including the OFF button, before removing the Unilink cable to prevent the mechanism from accidentally moving from the locked position).



Filename: CAR0359.SB  
Directory: J:\SBDOC\MAY95  
Template: C:\WINWORD\S\_BULL.DOT  
Title:  
Subject:  
Author: Hoyt Wing Lee  
Keywords:  
Comments:  
Creation Date: 05/01/95 11:00 AM  
Revision Number: 2  
Last Saved On: 05/01/95 11:00 AM  
Last Saved By: Hoyt Wing Lee  
Total Editing Time: 0 Minutes  
Last Printed On: 04/01/96 9:41 AM  
As of Last Complete Printing  
Number of Pages: 1  
Number of Words: 217 (approx.)  
Number of Characters: 1,237 (approx.)