

# Car Stereo Service Bulletin

**CSA-14**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** MDX-40/400

**No.** 360

**Subject:** Audio Skipping

**Date:** May 1, 1995

**Symptom:**

(57) The audio skips when playing pre-recorded and recordable discs.

**Solution:**


In some cases, this problem may be eliminated by replacing ferrite bead inductors FB304 and FB307 with 0 ohm jumper resistors. If installing the jumper resistors fails to correct the problem, conventional troubleshooting techniques should be used.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
FB304 FB307	INDUCTOR, FERRITE BEAD	1-414-235-11	RESISTOR, 0 OHM	1-216-295-11

Applicable serial numbers

MDX-40: 11669 ~ 17049

MDX-400: 15187 ~ 20899

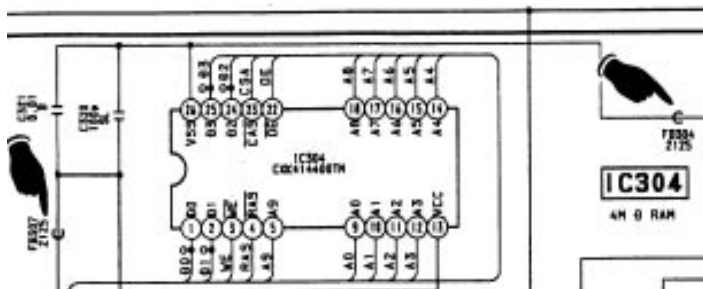





Filename: CAR0360.SB  
Directory: J:\SBDOC\MAY95  
Template: C:\WINWORD\S\_BULL.DOT  
Title:  
Subject:  
Author: Hoyt Wing Lee  
Keywords:  
Comments:  
Creation Date: 05/01/95 10:46 AM  
Revision Number: 2  
Last Saved On: 05/01/95 10:46 AM  
Last Saved By: Hoyt Wing Lee  
Total Editing Time: 0 Minutes  
Last Printed On: 04/01/96 9:39 AM  
As of Last Complete Printing  
Number of Pages: 3  
Number of Words: 161 (approx.)  
Number of Characters: 922 (approx.)