

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: EXR-21; XR-6450/C210/C410/C620

No. 364

Subject: Tape Does Not Eject.

Date: May 1, 1995

Symptom:

(65)

The unit will not eject the tape. Examination of the mechanism shows that one or more of the gears on the reel bracket assembly (ref. 128) are damaged.


Solution:

Replace the reel bracket assembly. Prevent recurring damage to the reel bracket assembly by installing a mode lever service assembly kit as shown below.

REF	DESCRIPTION	PART NUMBER
128	BRACKET ASSY, REEL	X-3368-842-1
-	MODE LEVER SERVICE ASSY	X-3370-516-1

Applicable Serial Numbers

XR-C210 (amber illumination): up to 11175
XR-C210 (green illumination): up to 296799
XR-C410 (amber illumination): up to 85599
XR-C410 (green illumination): up to 94331
XR-C620: up to 13740
XR-6450: up to 15000
EXR-21: up to 14000

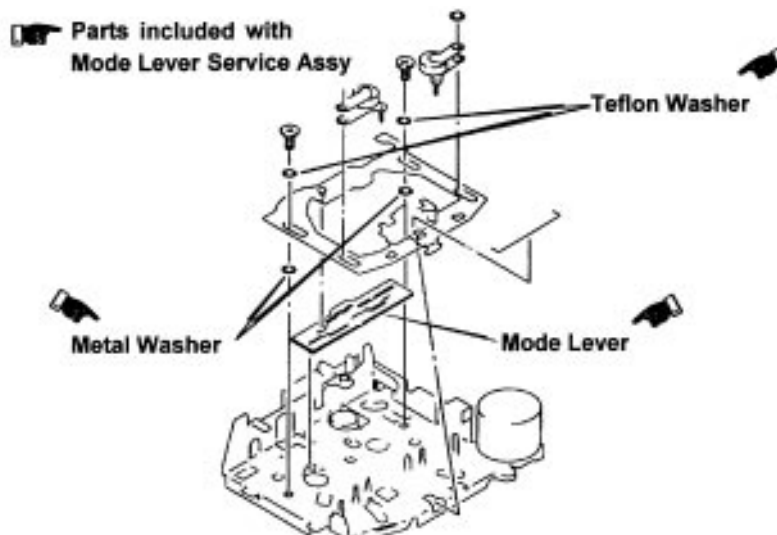

Filename: CAR0364.SB
Directory: J:\SBDOC\MAY95
Template: C:\WINWORD\S_BULL.DOT
Title:
Subject:
Author: Hoyt Wing Lee
Keywords:
Comments:
Creation Date: 05/01/95 1:36 PM
Revision Number: 2
Last Saved On: 05/01/95 1:36 PM
Last Saved By: Hoyt Wing Lee
Total Editing Time: 0 Minutes
Last Printed On: 04/01/96 9:41 AM
As of Last Complete Printing
Number of Pages: 2
Number of Words: 182 (approx.)
Number of Characters: 1,043 (approx.)