

# Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-600DSP/900/5060/5070/5260/  
5460/5470/U6260; EXCD-60

**No.** 373

**Subject:** Test Mode Error Codes.

**Date:** August 22, 1995

## Symptom:

(\*\*) The list on page 2 represents the error codes which may appear when operating the above mentioned models in the test mode. Some models display a 2-digit code, while others display a 4-digit code. The last 2 digits of the 4-digit code are always "F0".

2-Digit Error Code Models:	CDX-5060 CDX-5070 CDX-5260 CDX-5270 CDX-5460 CDX-5470 EXCD-60
4-Digit Error Code Models:	CDX-600DSP CDX-900 CDX-U6260

cont.



## Audio Products Service Bulletin No. 373

The error codes are displayed in the following format:

2-digit error code models: "E- n1 n2"; 4-digit error code models: "ERR- n1 n2 F 0"

n1	n2
0= No Magazine *	0
1= Servo Error	1= Focus not on 2= Spindle runaway (GFS low for 5 seconds) 3=Sled maximum time exceeded 4= Tracking not on (GFS not achieved at start of play) 5= TOC data unreadable
2 = Selected Disc Not Present *	0
3= Loading/Eject Error	1= Disc position sensor maximum detection time exceeded 2= Foreign object, or perhaps an 8cm disc adapter without a disc, has been inserted. 3= Maximum time from load start to chucking complete exceeded 4= Maximum time from eject start to eject complete exceeded.
4 = Skipping	1= Loss of focus while playing 2= Inadvertant track jump 3= Hang up
8= Self-Store (this means that after the disc is ejected at the end of the test mode, the disc was automatically reloaded because the operator did not remove the disc within 15 seconds).	0
C= No Discs Found In Magazine *	0
D= High Temperature In Mechanism	0
F= Mechanism Can't Complete Process *	1= CBS (Come Back Search) 2= DGS (Disc Get Search) 3= Load 4= Save 5= LVO (Lever Out) 6= GTH (Go To Home) 7= Eject 8= PSET (Magazine Set) 9= Forced Eject A= GTH (Go To Home at reset) F= EEPROM error

**Audio Products Service Bulletin No. 373**

\* These codes may appear while a CD changer is connected to the unit and playing during test mode.